

Novamid[®] 1013C4

PA6

Low Viscosity, Injection Molding

Print Date: 2024-03-22

GRADE CODING

Novamid[®] PA6 non reinforced and non flame retardant injection molding grades.

MATERIAL HANDLING

Storage

In order to prevent moisture pick up and contamination, supplied packaging should be kept closed and undamaged. For the same reason, partial bags should be sealed before re-storage. Allow the material that has been stored elsewhere to adapt to the temperature in the processing room while keeping the bag closed.

Packaging

Novamid[®] grades are supplied in airtight, moisture-proof packaging.

Moisture content as delivered

Novamid[®] grades are packaged at a moisture level ≤ 0.15 w%.

Conditioning before molding

To prevent moisture condensing on granules, bring cold granules up to ambient temperature in the molding shop while keeping the packaging closed.

Moisture content before molding

Novamid[®] is delivered at molding moisture specification (≤ 0.15 w%). We advise to pre-dry to overcome the fluctuation from package to package (see drying section below). Furthermore, pre-drying is required in case the material is exposed to moisture before molding (prolonged storage or open/damaged packaging).

Moisture content can be checked by water evaporation methods or manometric methods (ISO 15512).

All the trademarks mentioned here are trademarks of Envalior.
Seller represents and warrants exclusively that on the date of delivery by Seller the product shall be in conformity with the specifications agreed upon. Seller makes no other representations or warranties, whether express or implied.
Seller is not responsible or liable for the design of the products of the Customer and it is the responsibility of the Customer to determine that the Seller's product is safe, complies with application laws and regulations, and is technically or otherwise fit for its intended use. Seller does not endorse or claim suitability of its products for a specific application and disclaims each and every representation or warranty, whether express or implied, in that respect.

Typical values are indicative only and are not to be construed as being binding specifications. Colorants in the product or other additives may cause significant variations in typical values.

Copyright © Envalior 2024. All rights reserved. No part of the information may be reproduced, distributed, or transmitted in any form or by any means, including photocopying, recording, or other electronic or mechanical methods, without the prior written permission of Envalior.

Recommendations for injection molding

Novamid® 1013C4

Print Date: 2024-03-22

Drying

Novamid® grades are hygroscopic and absorb moisture from the air relatively quickly. Moisture absorption is fully reversible under the following drying conditions without compromising material quality. Preferred driers are de-humidified driers with dew points maintained between -30 and -40°C / -22 and -40°F. Vacuum driers with N₂ purge can also be used. Hot air ovens or hopper driers are not suitable for pre-drying Novamid® grades; the use of such driers may result in non-optimum performance.

Moisture content	Time	Temperature	
[%]	[h]	[°C]	[°F]
0.1-0.2 and as delivered	2-4	80	176
0.2-0.5	4-8	80	176

Drier types that are not de-humidified can be operated until 100°C but care has to be taken with natural/light colors for which a color change might be observed upon drying depending on time/temperature exposure.

Regrind

Regrind can be used taking into account that this regrind must be clean/low dust content/not thermally degraded/dry, of same composition and similar particle size as the original material. The acceptable level of regrind depends on the application requirements (e.g. UL Yellow Card). Be aware that regrind can cause some small color deviations.

All the trademarks mentioned here are trademarks of Envalior.
Seller represents and warrants exclusively that on the date of delivery by Seller the product shall be in conformity with the specifications agreed upon. Seller makes no other representations or warranties, whether express or implied.
Seller is not responsible or liable for the design of the products of the Customer and it is the responsibility of the Customer to determine that the Seller's product is safe, complies with application laws and regulations, and is technically or otherwise fit for its intended use. Seller does not endorse or claim suitability of its products for a specific application and disclaims each and every representation or warranty, whether express or implied, in that respect.

Typical values are indicative only and are not to be construed as being binding specifications. Colorants in the product or other additives may cause significant variations in typical values.

Copyright © Envalior 2024. All rights reserved. No part of the information may be reproduced, distributed, or transmitted in any form or by any means, including photocopying, recording, or other electronic or mechanical methods, without the prior written permission of Envalior.

Recommendations for injection molding

Novamid® 1013C4

Print Date: 2024-03-22

MACHINERY

Novamid® grades can be processed on general injection molding machines.

Screw geometry

Typically 3-zone screw designs with volumetric compression ratios of approximately 2.5 work fine.

Steel type

Abrasive resistant tool steels which are normally used for glass and/or mineral reinforced materials are also to be used for Novamid® polymers in tools, nozzles and screws.

Nozzle temperature control

The use of an open nozzle with good temperature control and an independently-controlled thermocouple nearby the tip and heater bands with sufficient output is recommended.

Hot runner layout

Try to achieve a close contact with your hot runner supplier and DSM as the material supplier, to be sure that the right hot runner system is chosen.

When processing Novamid® with hot runners, keep in mind these basic rules:

- Central bushing heated separately
- Only use external heated system
- Manifold heated from both sides
- Tip with thermocouple in front (near gate)
- Very accurate temperature control in the gate area

All the trademarks mentioned here are trademarks of Envalior.

Seller represents and warrants exclusively that on the date of delivery by Seller the product shall be in conformity with the specifications agreed upon. Seller makes no other representations or warranties, whether express or implied.

Seller is not responsible or liable for the design of the products of the Customer and it is the responsibility of the Customer to determine that the Seller's product is safe, complies with application laws and regulations, and is technically or otherwise fit for its intended use. Seller does not endorse or claim suitability of its products for a specific application and disclaims each and every representation or warranty, whether express or implied, in that respect.

Typical values are indicative only and are not to be construed as being binding specifications. Colorants in the product or other additives may cause significant variations in typical values.

Copyright © Envalior 2024. All rights reserved. No part of the information may be reproduced, distributed, or transmitted in any form or by any means, including photocopying, recording, or other electronic or mechanical methods, without the prior written permission of Envalior.

Recommendations for injection molding

Novamid® 1013C4

Print Date: 2024-03-22


TEMPERATURE SETTINGS

Mold temperature

Novamid® can be used with a wide range of tool temperatures (50 – 80°C / 122 – 176°F). However, we recommend a low mold temperature for parts with thick walls and a high mold temperature for good dimensional stability, flow properties and surface aesthetics. Furthermore, for impact modified grades (P in the grade coding) a low mold temperature can prevent mold sticking, resulting in a better surface appearance.

Barrel temperature

Optimal settings are governed by barrel size, residence time and melt viscosity. Be aware that melt viscosity is related to the barrel temperature settings. Due to the high melting point of Novamid® this temperature should be set high enough to provide a homogeneous melt without getting too near to the degradation temperature of 300°C / 572°F. A flat or rising temperature profile is recommended.

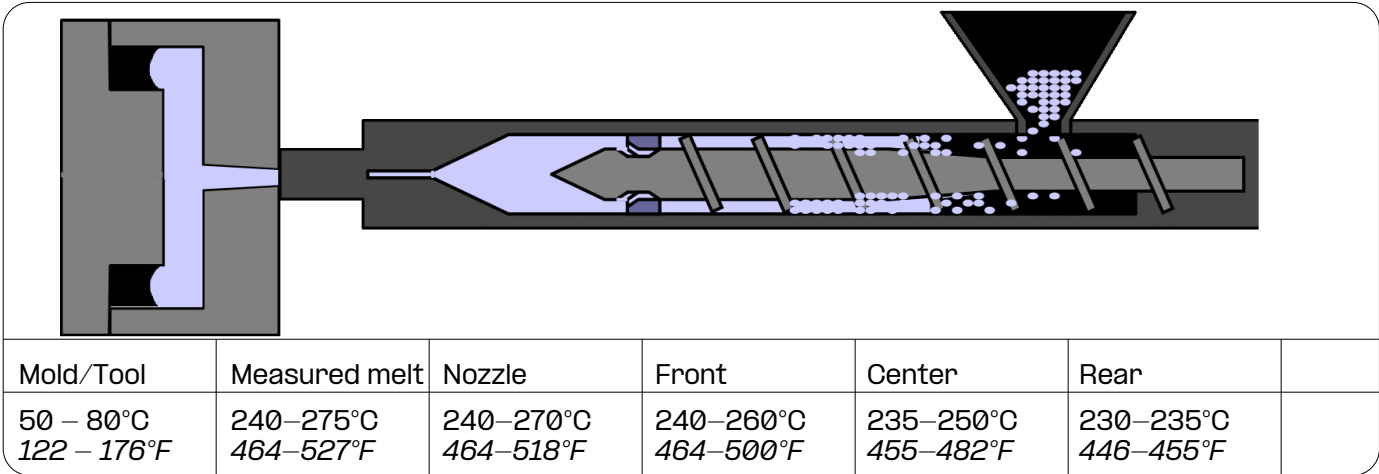

Melt temperature

To generate a good and homogeneous melt, the melt temperature should always be above 240°C / 464°F. Optimal mechanical properties will be achieved at melt temperatures between 240–275°C / 464–527°F. We advise to frequently measure the melt temperature by pouring the melt in a Teflon cup and inserting a thermo probe into the melt.

Hot runner temperature

A hot runner temperature set to the same level as the nozzle temperature should work fine and not lead to excessive overhear of the Novamid® grade. When starting up, an increased tip temperature may be necessary to overcome a frozen nozzle.

All the trademarks mentioned here are trademarks of Envalior.
Seller represents and warrants exclusively that on the date of delivery by Seller the product shall be in conformity with the specifications agreed upon. Seller makes no other representations or warranties, whether express or implied.
Seller is not responsible or liable for the design of the products of the Customer and it is the responsibility of the Customer to determine that the Seller's product is safe, complies with application laws and regulations, and is technically or otherwise fit for its intended use. Seller does not endorse or claim suitability of its products for a specific application and disclaims each and every representation or warranty, whether express or implied, in that respect.

Typical values are indicative only and are not to be construed as being binding specifications. Colorants in the product or other additives may cause significant variations in typical values.

Copyright © Envalior 2024. All rights reserved. No part of the information may be reproduced, distributed, or transmitted in any form or by any means, including photocopying, recording, or other electronic or mechanical methods, without the prior written permission of Envalior.

Recommendations for injection molding

Novamid® 1013C4

Print Date: 2024-03-22

GENERAL PROCESSING SETTINGS

Screw rotation speed

To realize a good and homogeneous melt, it is advised to set a screw rotation speed resulting in a plasticizing time that is just within the cooling time.

The rotational speed of the screw should not exceed $6500 / D$ RPM (where D is the screw diameter in mm).

Back pressure

Back pressure should be between 30–100 bars effective. Keep it low in order to prevent nozzle-drooling, excessive shear heating and long plasticizing times.

Decompression:

In order to prevent nozzle drool after plasticizing and retracting the nozzle from the mold, a short decompression stroke can be used. However, to prevent oxidation of the melt, which may result in surface defects on the parts, it is recommended to keep this as short as possible.

Injection speed

Moderate to high injection speeds are required in order to prevent premature crystallization in the mold during injection phase and to obtain a better surface finish. Adequate mold venting is required to avoid burning at the end of the flow path (due to diesel effect).

Injection pressure

The real injection pressure is the result of the flowability of the material (crystallization rate, flow length, wall thickness, filling speed). The set injection pressure should be high enough to maintain the set injection speed (use set injection pressure higher than the peak pressure if possible). Tooling air vents must be effective to allow optimum filling pressure and prevent burn marks.

Holding time

Effective holding time is determined by part thickness and gate size. Holding time should be maintained until a constant product weight is achieved.

Holding pressure

The most adequate holding pressure is the level whereby no sinkmarks or flash are visible. A too high holding pressure can lead to stresses in the part.

Cooling Time

Actual cooling time will depend on part geometry and dimensional quality requirements as well as the tool design (gate size).

All the trademarks mentioned here are trademarks of Envalior.

Seller represents and warrants exclusively that on the date of delivery by Seller the product shall be in conformity with the specifications agreed upon. Seller makes no other representations or warranties, whether express or implied.

Seller is not responsible or liable for the design of the products of the Customer and it is the responsibility of the Customer to determine that the Seller's product is safe, complies with application laws and regulations, and is technically or otherwise fit for its intended use. Seller does not endorse or claim suitability of its products for a specific application and disclaims each and every representation or warranty, whether express or implied, in that respect.

Typical values are indicative only and are not to be construed as being binding specifications. Colorants in the product or other additives may cause significant variations in typical values.

Copyright © Envalior 2024. All rights reserved. No part of the information may be reproduced, distributed, or transmitted in any form or by any means, including photocopying, recording, or other electronic or mechanical methods, without the prior written permission of Envalior.

MELT RESIDENCE TIME

The optimal Melt Residence Time (MRT) for Novamid® 1013C4 is ≤ 4 minutes with preferably at least 50% of the maximal shot volume used. The MRT should not exceed 6 minutes.

A formula to estimate the MRT is described below:

$$MRT = \frac{\pi D^3 \rho * t}{m \cdot 60}$$

Whereas:

MRT = Melt Residence Time [minutes]

D = Screw Diameter [cm]

ρ = Melt Density [g/cm³]

m = Shot Weight [g]

t = Cycle Time [s]

Please note: In the calculation above, the hotrunner volume has not been taken into account. When a hotrunner is part of the setup, please add the hotrunner volume to the calculation. A full self-service MRT calculation can be done using the following [link](#).

SAFETY

For the safety properties of the material, we refer to our SDS which can be ordered at our sales offices. During practical operation we advise to wear personal safety protections for hand/eye/body.

STARTUP/SHUT DOWN/CLEANING

Production has to be started and stopped with a clean machine. Cleaning can be done with Novamid® 1013C4, applicable cleaning agents or HDPE. Hot runners can also be cleaned and put out of production cleaning them with Novamid® 1013C4.

PRODUCTION BREAKS

During production breaks longer than a few minutes, we advise emptying the barrel. The temperature of the barrel and the hot runner [if applicable] should be reduced to a level far enough below the melting point of the compound in order to stop decomposition of the compound.

When the hot runner, nozzle, or even the screw is blocked, be aware that under these conditions a sudden outburst of molten material can take place. Always wear personal safety protections for hand/eye/body.

TROUBLESHOOTING

See our trouble shooting guidelines on the internet.

Contact Envalior in case more information is required from the aspect of material or processing.